BOYERTOWN AREA SCHOOL DISTRICT

SUPPORT SERVICES BUILDING

AHERA 6 Month Re-Inspection Report

November 2023

Table 1

Room by Room Inventory of Asbestos Containing Materials

| | | MATERIAL | | | | | | | | | | | | |
|------|----------------|-----------------|------|------|---|---|---|---|---|---|---|---|------|--------------------------|
| BLDG | ROOM/AREA | DESCRIPTION | SAMP | QNTY | L | D | | Α | A | Р | | | | |
| | | | NO | | S | С | E | Т | F | D | F | % | TYPE | COMMENTS |
| | Quigley Bus | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Office | Tile and Mastic | А | 130 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed under carpet |
| | Transportation | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Offices | Tile and Mastic | А | 250 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed under carpet |
| | Secretary's | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Office | Tile and Mastic | А | 260 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed under carpet |
| | Supervisor's | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Office | Tile and Mastic | А | 250 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed - exposed |
| | Entrance | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Foyer | Tile and Mastic | А | 360 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed - exposed |
| | | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Bathroom | Tile and Mastic | А | 40 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed - exposed |
| | | 12" x 12" Floor | | | | | | | | | | | | |
| 1 | Bathroom | Tile and Mastic | А | 30 | S | 0 | 4 | 2 | 1 | 2 | 1 | Α | | assumed - exposed |
| | | | | | | | | | | | | | | |
| | Throughout | Wall and | | | | | | | | | | | | |
| 1 | First Floor | Ceiling Plaster | А | | S | 1 | 1 | 1 | 1 | 2 | 2 | A | | assumed - need to sample |
| | | | | | | | | | | | | | | |
| | Throughout | Wall and | | | | | | | | | | | | |
| В | Basement | | А | | S | 3 | 1 | 1 | 1 | 2 | 2 | Α | | assumed - need to sample |
| | | | | | | | | | | | | | | |
| | | No suspect | | | | | | | | | | | | |
| | | Fire Doors | | | | | | | | | | | | |
| | | were found | | | | | | | | | | | | |

This AHERA 6 Month Re-Inspection was performed by Scott Schiel in November 2023 (#754246)

Table 2Summary of ACM

| Material | Estimated | | Estimated |
|---------------------------------|-----------|---|--------------|
| Description | Quantity | | Removal Cost |
| | | | |
| 12" x 12" Floor Tile and Mastic | 1320 | S | \$4,000 |
| | | | |
| Wall and Ceiling Plaster | unknown | | |
| | | | |
| | | | |
| ESTIMATED TOTAL | | | \$4,000 |

Table 3Recommended Response Actions

| Location | Material Description | Recommended Response Action | | | | | |
|---------------------|--------------------------------|--------------------------------------|--|--|--|--|--|
| Throughout Building | 12" x12" Floor Tile and Mastic | Handle remaining under O & M Program | | | | | |
| | | | | | | | |
| | | | | | | | |
| Throughout Bldg | Wall & Ceiling Plaster | Handle remaining under O & M Program | | | | | |
| | | Sample prior to removal | | | | | |

Support Services Building 6-Month AHERA - November 2023

Table 4Summary of Response Actions Taken

There has been no known or documented asbestos response actions performed in the Support Services Building since the last AHERA 3 Year Re-Inspection, which was conducted in November 2021.